

TECHNICAL INFORMATION #920

ZIB-113

To: ICOM Distributors
 From: ICOM Inc. / CS Department
 Date: October 15, 2002

Service handling necessary: <input checked="" type="checkbox"/> Yes <input type="checkbox"/> No
--

Re: IC- 7400/IC-746PRO Modification No.124

The following modification is regarding the improvement of IC-7400 and IC-746PRO.

Symptom: No output power on the TX mode.

Cause: The IC151 is damaged because of static electricity.

Solution: Add two PIN diodes on receiving line as follows,

Board	Parts Number	Parts Number (Old)	Parts Number (New)	Action Taken
RF 130	D.1	NA	1750000350 S.DIODE TOSHIBA 1SV252	Add
RF 130	D.2	NA	1750000350 S.DIODE TOSHIBA 1SV252	Add



